

KXB3080 MANUAL ERRATA

Rev. A-1, April 14, 2006

**THESE MANUAL CORRECTIONS MUST BE MADE
BEFORE YOU BEGIN ASSEMBLY,
OR YOUR KX1 WILL NOT FUNCTION CORRECTLY**

1. **Page 1, top of page:** Above “Introduction” add the following note:

 **Your KX1 must have an 18-turn inductor installed at L3 before using it on 80 meters. If L3 in your KX1 has only 6 turns, see “KX1 Builder’s Alert, Modifying Final Amplifier Choke L3” for instructions on how to rewind the inductor. The wire required for the “KX1 Builder’s Alert” is included with your KXB3080 kit.**

2. **Page 15, last step:** Add this sentence:

Carefully check the routing of green wire L2-1 and ensure it does not short against the solder pad for L2-4 at the corner of the LPF1 board or touch the L2-4 wire.